IH 101500
Heat Stress Measurements
(Area Monitoring & Personal Dosimetry)

Contents

1.0 Purpose/Scope
2.0 Responsibilities
3.0 Definitions
4.0 Prerequisites
5.0 Precautions
6.0 Procedure
7.0 Implementation & training
8.0 References
9.0 Attachments
10.0 Documentation

1.0 Purpose/Scope

This procedure provides a standardized method for the operation of the *QUESTemp 15* Area Heat Stress Monitor and *QUESTemp II* Personal Heat Stress Monitors. This procedure includes mechanisms for disseminating results to the BNL population by the SHSD Heat Stress Notification system.

The *QUESTemp 15* used as an area monitor surveys the workplace heat stress. The site level monitoring determines risk to outdoor workers in typical work clothing (long pants and short sleeve shirt of cotton or cotton blend). The site wide area monitoring data is not representative of:

- Work in artificially elevated heat situations such as near ovens and other large heat sources. Conduct area monitoring for workers near heat sources using a *Questemp34* placed in the local environment of these workers.
- Indoor work. Conduct area monitoring for workers in indoor areas using a *Questemp34* placed in the local environment of these workers.
- Work while wearing moisture resistant protective clothing such as Tyvek or “PCs”. Conduct personal dosimetry via *QuestTemp II* or physiological body measurements.

The QUESTemp° II monitor tracks an individual’s body temperature for indications of the onset of heat stress. It warns the user when their personal body temperature has risen above the "safe" level and that action should be taken to allow the body to cool.

2.0 Responsibilities

2.1 Personnel that perform exposure monitoring with this instrument are responsible to follow all steps in this procedure.

2.2 The data collected using this meter must have an appropriate evaluation of the hazard and risk by a cognizant Industrial Hygiene professional.

3.0 Definitions

Acclimated Worker: physiological adoptions that improve performance in heat that occurs typically after 3 weeks of continued physical activity under heat stress conditions similar to those in the anticipated work. Acclimatization begins to be lost after 4 days of discontinued work.

Heat Stress is the net heat load to which a worker may be exposed from the combined contributions of metabolic, cost of work, environmental factors (i.e. air temperature, humidity, air movement and radiant heat exchange) and clothing requirements.

Occupational Exposure Limit (OEL): Heat stress is typically regulated in the workplace with regard to either the WBGT index (Wet Bulb Globe Temperature) or the individual's body indicators (core temperature & heart rate). BNL uses the ACGIH screening criteria for heat stress exposure to determine work/rest regimens under normal operations and core body temperature or heart rate when water-vapor-impermeable, air-impermeable or thermally insulating work clothes are worn.

Wet Bulb Globe Temperature (WBGT): a measurement of ambient heat that factors in the influence of wind speed and relative humidity to estimate the risk to workers from heat stress illnesses. Used as screening criteria regulating the work/rest regimen for various levels of the index. This is based on the air temperature, radiant heat, and humidity.

4.0 Prerequisites:

Obtaining BNL Web Passwords to access computer for site notification portion of this procedure.

5.0 Precautions

Hazard Determination: The operation of this meter does not cause exposure to any chemical, physical, or radiological hazards. The meter design does not cause significant ergonomic concerns in routine use. The meter does not generate Hazardous Waste or environmental impact.

Personal Protective Equipment: No PPE is needed to operate this equipment.

Dosimeter Calibration: Failure to calibrate the *QUESTemp II* prior to use may result in an increased margin of error in the results.

6.0 Procedure

Site monitoring

6.1 Check the weather in the morning during seasons when the temperature is expected to reach 81°F or higher. If the forecast is for temperatures more than 81°F, set up the area heat stress monitor (*QUESTemp 15*).

6.2 Prepare the *QUESTemp 15* meter for outdoor monitoring by placing the sensor head on a tri-pod outside at a height of about 3' from the ground. The meter should be back from the paved street and aligned with the green Building 120 sign on the south side of the building. Secure the tripod legs and the hoop rings.

6.3 Run the data cable out of the lab room's window to the meter head. Make a loop of the cable around the meter head, so it isn't easily pulled out by movement of the cable. Plug the cable into the base of the unit.

6.4 Run the caution flags from the unit to the building, so no one trips or runs over the wire.

6.5 Operate the *QUESTemp 15* Meter per Attachment 9.1.

6.6 Operate the BNL Heat Stress Site Notification system per Attachment 9.3.

6.7 If any heat stress alert e-mails are sent throughout the day (this is done automatically through the system) print them as well to attach to the log.

6.8 Record Retention: File the printed record or handwritten version of the meter log and field sheets in the SHSD File Code 101.

Local conditions monitoring

6.9 If work is done in a setting not covered by the centralized outdoor monitoring site at Building 120 (such as work within buildings that are not conditioned with poor air flow), use the *QUESTemp 34* Meter to monitor the local conditions. Operate the meter as per Attachment 9.2.

Personnel dosimetry

6.10 If outdoor work is done on site in encapsulated suits that prevent the site monitoring from representing the heat stress condition, use the *QUESTemp II* Dosimeter to monitor the workers. Operate the dosimeter as per Attachment 9.4

7.0 Implementation & Training: The monitoring employee's supervision determines their qualification based on the JPM in Attachment 9.5, or an equivalent. Personnel shall re-qualify on at least a three year basis.

8.0 References

- *QUESTemp 15, QUESTemp 34, and QUESTemp II* Operator's Manuals.
- BNL Subject Area Natural Hazards in the Environment
- ACGIH American Conference of Governmental Industrial Hygienists, Threshold Limit Values for Chemical Substances and Physical Agents and Biological Exposure Indices, 2005.

9.0 Attachments

9.1 *QUESTemp 15* Area Heat Stress Monitor- Operator Aid
9.2 *QUESTemp 34* Area Heat Stress Monitor- Operator Aid
9.3 Site Heat Stress Notification System- Operator Aid
9.4 *QUESTemp II* Personal Heat Stress Dosimeter- Operator Aid
9.5 Job Qualification form

10.0 Documentation

Document Development		
PREPARED BY: *(Signature and date on file)* **E. Lacina** **Author** **Date 07/30/04**	**REVIEWED BY:** *(Signature and date on file)* **J. Peters** **SHSD IH Group** **Date 7/30/04**	**APPROVED BY:** *(Signature and date on file)* **R. Selvey** **SHSD IH Group Manager** **Date 101500 05/08/01** **101600 09/08/04**
ESH Coordinator/ Date: *none*	Work Coordinator/ Date: *none*	SHSD Manager / Date: *none*
QA Representative / Date: *none*	Training Coordinator / Date: *none*	*S & H Representative: none*
Facility Support Rep. / Date: *none*	Environ. Compliance Rep. / Date: n*one*	Other: none
ISM Review - Hazard Categorization ☐ High ☒ Moderate ☐ Low/Skill of the craft	Validation: ☐ Formal Walkthrough ☐ Desk Top Review ☐ SME Review	Implementation: Training Completed: Tracked in BTMS Document Control: 05/17/07 JRA review: 08/17/12

Revision Log
Rev 1: Purpose: Clarify/enhance procedural controls Changed resulting from: SHSD JRA-15 discussion on hazard controls. Description of change: Minor changes to Section 4 and 7 to reflect current qualification process. Text changes to 6.4 to indicate the worker should insert the plug into the ear not the sampling SME. Revised the format of Section 10 to the most recent format. SME Reviewer/Date: (signature on file) **R. Selvey 07/07/06**
Rev 2: Purpose: Clarify/enhance procedural controls Changed resulting from: Improvement action. Description of change: Added document control to the Attachment 9.6. SME Reviewer/Date: (signature on file) **R. Selvey 05/17/07**
Rev 3: Purpose: Periodic review. Changed resulting from: Improvement action. Description of change: Minor text changes in Section 1,2,6 for brevity. SME Reviewer/Date: (signature on file) **R. Selvey 11/02/10**
Rev 4: Purpose: Change in Scope Changed resulting from: Improvement action. Description of change: Rev4 Merger of IH101450 and addition of *QUESTemp 34* meter. SME Reviewer/Date: R. Selvey 10/01/09
Rev5: Purpose: Change in Scope Changed resulting from: Improvement action. Description of change: Merger of IH101600 Dosimetry into a single SOP. Changes to computer log in for Oracle database. SME Reviewer/Date: R. Selvey 08/17/12

Attachment 9.1: *QUESTemp 15* - Operator Aid

Equipment:

- Meter Body
- Battery (9 volt alkaline)
- Temperature Sensing Head
- Data Cable
- Printer Cable
- Computer
- Printer
- Bottle with Distilled or De-ionized Water

Meter Body

Temperature Sensing Head

Globe / Dry Bulb / Wet Bulb Thermometers

1. Electronic warm-up is not required for this meter.
2. The sensor head should be placed in the environment for 15 minutes before logging data so that the thermometers can equilibrate with that area.
3. Place the sensor head at shoulder height (on a tripod) in a location that will not be in the shade for the entire sampling period and is not sheltered from the prevailing winds.
4. Connect the meter sensor head to the meter body via the appropriate data cable or directly into the top of the meter.
5. **Water to thermometers:** Add distilled or de-ionized water to the wick of the wet bulb thermometer before use. Check it at least every two hours and add when no pooled liquid is visible.
6. Turning the meter on: Press the <On/Off> button on the meter.
7. Check the meter setting.
   - Check the print rate: It needs to be on 9600 Baud rate during operation. To change the setting, press "Print" twice, then use the arrow key to set "9600" baud rate.
   - Check the clock/date by pressing "Clock". To change the setting, press "Clock" twice, then use the arrow key to change the settings.

8. Clear the memory by holding the <Reset> button for the 3-2-1-0 count down. The Meter then displays "- - -".
9. Press <Run/Stop>. Data now logs automatically.
10. **Recording readings:** Use the BNL Heat Stress Record Instrument Form (or logger printout) to record readings.
    If data logging was used, connect meter to a printer via the data port on the left side.
11. Activate printing by pressing <Print> and <Enter>. If nothing prints, double click <Print> and use the < → > until "PrII" is displayed, then press <enter>.
12. After data is printed out, clear the memory for next day by holding the <Reset> button for the 3-2-1-0 count down. The Meter then displays "- - - ".

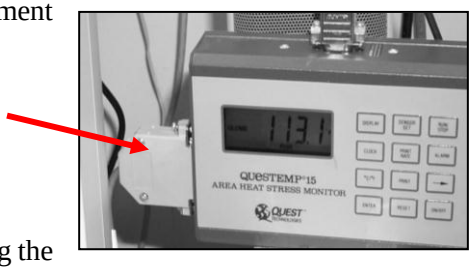

Example of a Print-out from the Questemp 15 meter.

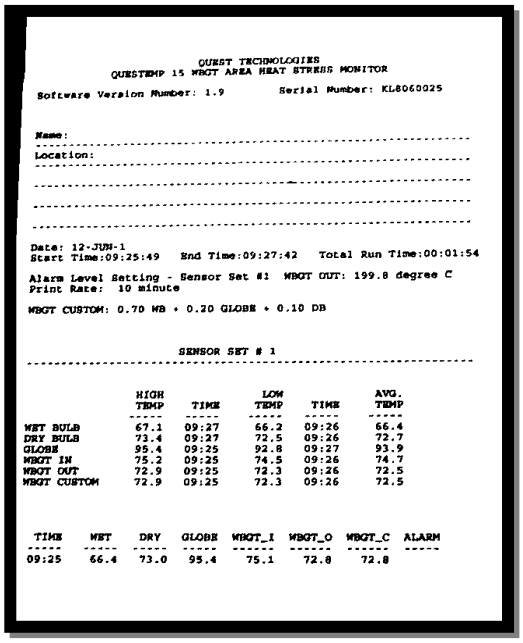

QUEST TECHNOLOGIES
QUESTEMP 15 WBGT AREA HEAT STRESS MONITOR

Software Version Number: 1.9 Serial Number: KL8060025

Name:
Location:

Date: 12-JUN-1
Start Time:09:25:49 End Time:09:27:42 Total Run Time:00:01:54

Alarm Level Setting - Sensor Set #1 WBGT OUT: 199.8 degree C
Print Rate: 10 minute

WBGT CUSTOM: 0.70 WB + 0.20 GLOBE + 0.10 DB

SENSOR SET # 1

	HIGH TEMP	TIME	LOW TEMP	TIME	AVG. TEMP
WET BULB	67.1	09:27	66.2	09:26	66.4
DRY BULB	73.4	09:27	72.5	09:26	72.7
GLOBE	95.4	09:25	92.8	09:27	93.9
WBGT IN	75.2	09:25	74.5	09:26	74.7
WBGT OUT	72.9	09:25	72.3	09:26	72.5
WBGT CUSTOM	72.9	09:25	72.3	09:26	72.5

TIME	WET	DRY	GLOBE	WBGT_I	WBGT_O	WBGT_C	ALARM
09:25	66.4	73.0	95.4	75.1	72.8	72.8	

Sample of the Heat Stress-Area Survey Form

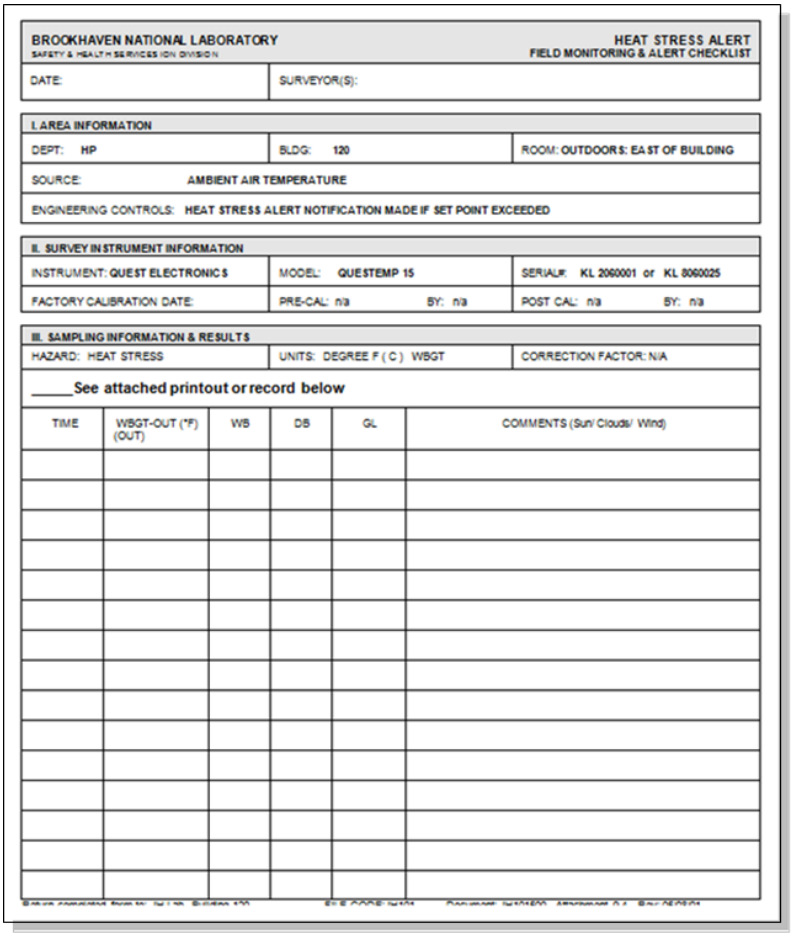

BROOKHAVEN NATIONAL LABORATORY
SAFETY & HEALTH SERVICES ION DIVISION

HEAT STRESS ALERT
FIELD MONITORING & ALERT CHECKLIST

DATE:	SURVEYOR(S):

I. AREA INFORMATION

DEPT: HP	BLDG: 120	ROOM: OUTDOORS: EAST OF BUILDING
SOURCE: AMBIENT AIR TEMPERATURE		
ENGINEERING CONTROLS: HEAT STRESS ALERT NOTIFICATION MADE IF SET POINT EXCEEDED		

II. SURVEY INSTRUMENT INFORMATION

INSTRUMENT: QUEST ELECTRONICS	MODEL: QUESTEMP 15	SERIAL#: KL 2060001 or KL 8060025
FACTORY CALIBRATION DATE:	PRE-CAL: n/a BY: n/a	POST CAL: n/a BY: n/a

III. SAMPLING INFORMATION & RESULTS

HAZARD: HEAT STRESS	UNITS: DEGREE F (C) WBGT	CORRECTION FACTOR: N/A

_____See attached printout or record below

TIME	WBGT-OUT (°F) (OUT)	WB	DB	GL	COMMENTS (Sun/ Clouds/ Wind)

Attachment 9.2: *QUESTemp 34* – Operator Aid

Equipment:

- Meter Body
- Battery (9 volt alkaline)
- Temperature Sensing Head
- Bottle with Distilled or De-ionized Water

1. Electronic warm-up is not required for this meter.
2. The sensor head should be placed in the environment for 10 minutes before logging data so that the thermometers can equilibrate with that area.
3. Place the sensor head 3.5ft from ground on a tripod in a location that will not be in the shade for the entire sampling period and is not sheltered from the prevailing winds.
4. Connect the meter sensor head to the meter body via the appropriate data cable or directly into the top of the meter.
5. Add distilled or de-ionized water to the wick of the wet bulb thermometer before use. Check it at least every two hours and add when no pooled liquid is visible.
6. Turning the meter on: Press the <I/O Enter> button on the meter.
7. Clear the memory by pressing the <I/O> key to enter the reset mode. Clear the memory by holding down the <I/O ENTER> key for the 3-2-1-0 count down.
8. Press <Run/Stop>. Data now logs automatically.
9. Recording readings: Use the BNL Heat Stress Record Instrument Form (or logger printout) to record readings.
10. If data logging was used, connect meter to a printer via the data port on the left side.
11. Activate printing by selecting “Print” from the menu, then pressing <I/O Enter> to enter the print mode. Begin printing by pressing the <I/O Enter> key.

Attachment 9.3:
BNL Heat Stress Notification Web Page – Operator Aid

1. Connect *QUESTemp 15* meter to computer via the data cable (from the meter to the toggle switch on the wall by the window in Building 120 lab).
   Move the Toggle switch to "**meter**"
2. Start up the computer in the IH Lab and log on with your BNL account. Use the password assigned to your account.

3. **Right** click on the **<*Heat Stress*> *Icon*** on the desktop.
   Chose **<Run Elevated>**
4. Pop-up box appears: In the Justification box, type: **"run program"**
   Enter your password, then press <**OK**>.
5. Oracle login pop-up box appears: Default user is: "/". Oracle server is: "***db2***" – don't enter anything – just press <**OK**>
6. Computer responds "*Connected to the Oracle Database*." Press **<OK>**
7. Select <**Monitor**> tab from the Heat Stress program's Menu Tool Bar on the computer screen.
8. Press **<Start>** on the computer screen. The Heat Stress program will turn on the meter, if it is off. The program will check the battery power status and warn the user if it is too low.
9. The computer will prompt: *"Verify the Following:"*
   Cable connected to COM1
   Monitor connected to Cable
   Monitor Baud Rate 9600".
   Check the status of the cables and meter. Press <***OK***>
10. Hold the <**Reset**> button on the meter for the 3,2,1,0 countdown to clear any previous data.
11. Press the <**Run/Stop**> button on the meter. (This starts the meter logging data).
12. Check the status of the meter. When prompted "*Verify monitor is on*", press <***OK*>.**
    Check that "Monitor Running" now appears on the computer screen.
13. View the wet bulb (WB), dry bulb (DB), globe (GL), and WGBT Out temperatures by pressing the display button on the meter to toggle through the readings. Record this information every hour on the *Heat Stress Alert* form, if possible.
14. Periodically check the meter sensors to ensure the wet bulb is filled with distilled water.
15. At the end of the day press <**Run/Stop**> on the meter. This will end the data logging.
16. Move the Toggle switch on the wall to the Printer side
17. Press the <**Print**> button on the meter. The report will begin printing on the printer on the top shelf. Once it has stopped printing, press the first button on the top left side of the printer – it will print the last page of the report.
18. Attach this print out to the *Heat Stress Alert* form and include a copy of any e-mail alerts.
19. Press and hold the <**Reset**> button on the meter for the 3,2,1,0 countdown. This will clear the data for the next day's monitoring.

The *Main Heat Stress Monitoring Page* [configure tab] settings should be:
Com Port: **Com1;**
Time between sample:**1**
Samples in Average: **60**
Auto Update Web: **Yes**
Auto Send email: **Yes**
Auto Page: **No**

Attachment 9.4: *QUESTemp II* Dosimeter Operator Aid

Equipment: (Pictured in Attachment 9.1)
Meter Body with cable leading to a small ear mold.
Disposable E.A.R® foam earplug.
Replacement ear loops.
Oral temperature probe w/ disposable sheaths.
RS-232 Serial Computer/Printer Interface
9V Disposable Battery (60 Hrs. runtime)

Start the QUESTemp° II: Turn the meter on by pressing: ON/OFF.
The internal programming version number is displayed (1.7) until a key is depressed. If the battery is low "LO" appears on the screen.

Clear Data from the Memory: To clear the memory and calibration data, the instrument must be in the ***On*** mode.
Press RESET shows 0:03 in the display.
Press and hold the RESET **key** for three seconds as the display counts down from "0:03" to "0:01"then will go blank.
Release the RESET button will display "rES" The unit is then reset to the factory defaults.

Setting up and placing the temperature probe in the worker's ear canal:

- With clean hands, have the worker roll the disposable yellow E.A.R. foam ear plug (containing a black protruding tube) back and forth with the fingers until it forms a small crease-free cylinder.
- Using only light pressure to keep the E.A.R. plug rolled tight, gently slide the plug over the temperature sensor of the earmold assembly. The black tube should slide into the earmold leaving only the yellow foam plug visible. The sensor should fill the black tube of the E.A.R. plug with the tip lying flush with, or just inside of, the outer end of the tube.
- With the E.A.R. plug still rolled tight, have the worker hold on to the blue earmold and quickly insert the rolled up plug into the ear canal and hold it in place until it expands. [Discontinue inserting the plug if pain occurs.] The yellow portion of the earplug should be completely contained within the ear canal without any danger of hurting the inner ear. Fitting is easier if the outer ear is pulled outward and upwards during insertion. If the initial fit is inadequate, remove the plug and repeat the process.
- Allow 6 – 10 minutes for it to stabilize to the correct temperature.

Taking the oral temperature: Collect and record the oral core temperature of the worker utilizing either:

- The QuestempII Oral temperature probe (if provided) with disposable hygiene sheaths. (Attach

to the "Cal" connector on the front of the meter.

- An external oral thermometer.

When taking an oral temperature, the person should be rested and should not have had anything to eat or drink in the past 15 minutes. The probe should be kept under the tongue with the mouth closed. Record the temperature in degrees Celcius.

Entering the workers oral temperature into the meter: This procedure utilizes the oral thermometer reading from Step 6.5.
Pressing CAL once will display '0---'.
Pressing CAL a second time will blink '36.0' representing the core temperature. Adjust this value between 36.0 and 39.0 by pressing the (ARROW) ⇒ key until it displays the core temperature collected from the Oral temperature probe.
Then press ENTER to complete the calibration sequence. 'CAL' will momentarily appear in the display to indicate the CORE temperature minus the EAR temperature value was obtained and is added as an offset to the EAR temperature.

Set the alarm level: The alarm sounds automatically when the set point is reached. A secondary alarm is set as 0.5°C above the alarm set point. The alarm level should be adjusted based on the oral temperature using the formula:

(Oral Temperature°C + 2°C)

but should not be set to exceed: **38°C** for <u>non-acclimated</u> workers and
39°C for <u>acclimated</u> workers.

Example: A worker's oral temperature is 36.4C. 36.4C + 2C = 38.4C. Set the alarm for 38.0C for an unacclimitized worker and 38.4C for an acclimated worker.
The alarm level may be changed only if the memory is clear, prior to logging data. Once run time has accumulated, the unit must be reset to change the alarm level setting. To view/change the alarm level:
Press ALARM LEVEL to display the current alarm level setting.
Press ALARM LEVEL and (ARROW) ⇒ simultaneously and hold for three seconds. The displayed level will flash and can be altered between 38°C and 39°C using the (ARROW) ⇒ key.
Set the alarm level using the (ARROW) ⇒ key.
Press ENTER when you have reached the appropriate alarm level.

Advise workers of the alarms. Inform them they must exit the area if the alarm sounds. The AUDIBLE ALARM sounds in the speaker located in the ear assembly under three conditions:
When the 10-second-average temperature in the ear canal exceeds the set alarm level (two pulses every second).
When the 10-second-average temperature in the ear canal exceeds O.5 °C above the set alarm level (four pulses every second).

When the battery voltage falls below 7.2 volts, continuous warning. The unit has stopped reading temperature data. Replace the battery immediately.

Start Logging: When work is ready to begin, Press RUN to begin operating and collecting data. Clip the meter to belt or place in a coat, suit, or pant's pocket.

Ending Logging: When monitoring is completed, turn off the unit by holding the ON/OFF key for three seconds. Data will be saved in the unit.

Recording separate events: You can separate the logging into "events" (such as before and after breaks for lunch) by turning the unit off. Shut down the unit by pressing and holding the ON/OFF key for three seconds. This will shut down the instrument for events such as leaving for lunch. Turn the unit on by pressing ON/OFF key, then press RUN again to begin a new event upon return to work.

Discard the yellow ear plug:

- Between workers
- At the end of the day or
- If the plug becomes soiled.

Documenting Sampling Data and Work Conditions readings:
Recorded data may be printed directly to a serial printer or downloaded to a computer.
Provide a copy of the printed data, to the SHSD IH Laboratory Record Custodian.
Notify the monitored employee of results.

Results interpretation:
Data reports are to be reviewed by the cognizant IH professional to determine adequacy of controls, actions taken and corrective actions as needed.
Ensure that a copy of the hazard evaluation report is sent to the IH Laboratory and is included in the ESHQ Directorate Recordkeeping system.
Ensure that a copy of the written hazard evaluation report is sent to the Occupational Medicine Clinic with the worker's BNL Life Number noted.

Printing or Downloading Stored Data

Printing of Logged Data: All logged information can be sent to a computer or serial printer using an RS232 serial protocol. The amount of data printed is determined by the PRINT RATE key on the *QUESTemp° II.*

Note that if the unit is in the RUN mode when printing is initiated, the RUN mode will be canceled and data logging will cease.

Printer Cables:
Connect the meter directly to a serial printer using cable #58-847. [A serial printer's input is typically a 25 pin female (holes) connector. Do not use cable #58-847 in conjunction with a computer's printer cable because that connects into the printer's parallel input port. Many printers are parallel only and can not accept data from the *QUESTemp° II.* For printers that have both serial and parallel inputs, refer to the printer's manual for configuring the serial port.)

Computer Cables:
Connect the meter to a computer using cable #58-867 for a 25 pin serial port. (The standard for a computer's serial port is a 25 pin or a 9 pin male (pins) connector. Do not connect to the computer's printer output port which is a 25 pin female (holes) connector. If you have cable #58-867 but your computer's serial port has only 9 pins, then you may use a 25 to 9 pin converter available at most computer or electronic stores. No other cables should be used.)

Computer Downloading using Windows™:
There is a variety of commercially available software that can easily accept data from the QUESTemp° II. These software packages are usually termed "communications software". Microsoft Windows ™ has a communications program under the ACCESSORIES icon called TERMINAL. Instructions on how to use TERMINAL are located in the Windows ™ manuals.

Using any of these communications programs, the user must select the com (serial) port and the baud rate. The Quest cable must be plugged into the selected com port and the baud rate on the unit must match the rate selected in the software. The PC programs also need the following information in their setup:

data bits = 8 stop bits = 2 parity = none handshaking (flow control) = hardware

For TERMINAL, the settings are found by first selecting SETTINGS, then COMMUNICATIONS.

- To initiate printing, use the following sequence: with the unit ON, plug the printer cable into the OUTPUT port of the QUESTemp° II. Be sure the desired PRINT RATE is selected (see the key function PRINT RATE).
- Press the PRINT/DATA key. If the default baud rate (speed of data transmission) in the display is not the desired baud rate, press the PRINT/DATA key a second time and use the ARROW key to select a new rate. [If you are downloading to a computer, be sure that it is ready to accept data prior to moving to step 6.5.3)
- Press ENTER and the data will be sent. "Prn" will appear in the display until all of the data has been sent.
- To halt printing, simply press the PRINT/DATA key while "Prn" is still in the display.

Example of a Print-out from the *QUESTemp° II* meter.

QUEST ELECTRONICS
QUESTEMP II Personal Temperature Monitor

Serial Number: JU1030001 Software Version Number: 1.1

Name: Date:

Location:

SAMPLE

[1]Start Time: 11:34 [2]End Time: 13:32 [3]Total Run Time: 01:58

[4]Alarm Level Setting: 38.0 oC
[5]Print Rate: 1 Min.

[6]High Temperature: 38.1 oC At Time: 13:32
[7]Low Temperature: 36.1 oC At Time: 11:34

[8]CAL in degree C	@ Time
0.4	11:41:20

SAMPLED DATA

Time Hr:Min	[9]Ear Temp. oC	oF	[10]Mold Temp. oC	oF	[11]Oral Temp. oC	oF	[12]Alarm
11:34	36.1	97.0	32.7	90.9			
11:35	36.1	97.0	32.7	90.9			
11:36	36.2	97.2	32.8	91.1			
11:37	36.3	97.4	32.9	91.3			
11:38	36.3	97.4	33.0	91.5			
11:39	36.4	97.5	33.1	91.7	36.7	98.1	
11:40	36.4	97.5	33.1	91.7	36.9	98.5	
11:41	36.4	97.5	32.9	91.3	36.9	98.5	
11:42	36.9	98.4	33.0	91.5			
11:43	36.9	98.4	33.0	91.5			
13:29	37.9	100.2	27.6	81.7			
13:30	37.9	100.2	27.4	81.3			
13:31	38.0	100.4	27.3	81.1			*
13:32	38.1	100.6	27.2	80.9			**

Heat Stress Measurements

QUESTemp 15, QUESTemp 34, and QUESTemp II Monitors

Job Performance Measure (JPM) Completion Certificate

Candidate's Name	Life Number:

	Element of Qualification	Unsatis-factory	Recov-ered	Satisf-.actory
	Principles of Heat Stress			
1	Has knowledge of heat stress temperature measurement and the reason for sampling.			
2	Understands the varying methods of heat stress monitoring and when each is appropriate.			
	Set up of meter			
1	Can demonstrate how to assemble and activate the meter. ☐ *QUESTemp 15* ☐ *QUESTemp II* Dosimeter ☐ *QUESTemp 34* ☐ Other:			
2	*QUESTemp 15* & 34: Can demonstrate how to: Place the meter outdoors and Add water to thermometer			
3	Site Notification- Can demonstrate how to Log onto computer w/ password; Log onto BNL network w/ password; Log on to Oracle w/ password; Run the Heat Stress evaluation program			
4	*QUESTemp II* Dosimeter: Can demonstrate how to calibrate (adjust for body core temperature), set alarm levels and operate the meter.			
5	Can demonstrate how to respond appropriately to alarms and recommend corrective actions			
	Documentation of Monitoring			
1	Demonstrates how to Download data and Print a hardcopy of monitoring data			
2	Knows the list of organizations and individuals to receive data reports and timeliness requirements.			

Employee: I accept the responsibility for performing this task as demonstrated within this JPM and the corresponding SOP.

Candidate Signature:	Date:

Evaluator: I certify the candidate has satisfactorily performed each of the above listed steps and is capable of performing the task unsupervised.

Evaluator Signature:	Date: